
ORIENT Inverter AC Error Codes

Category: air conditioner
written by www.mbsm.pro | 9 January 2026

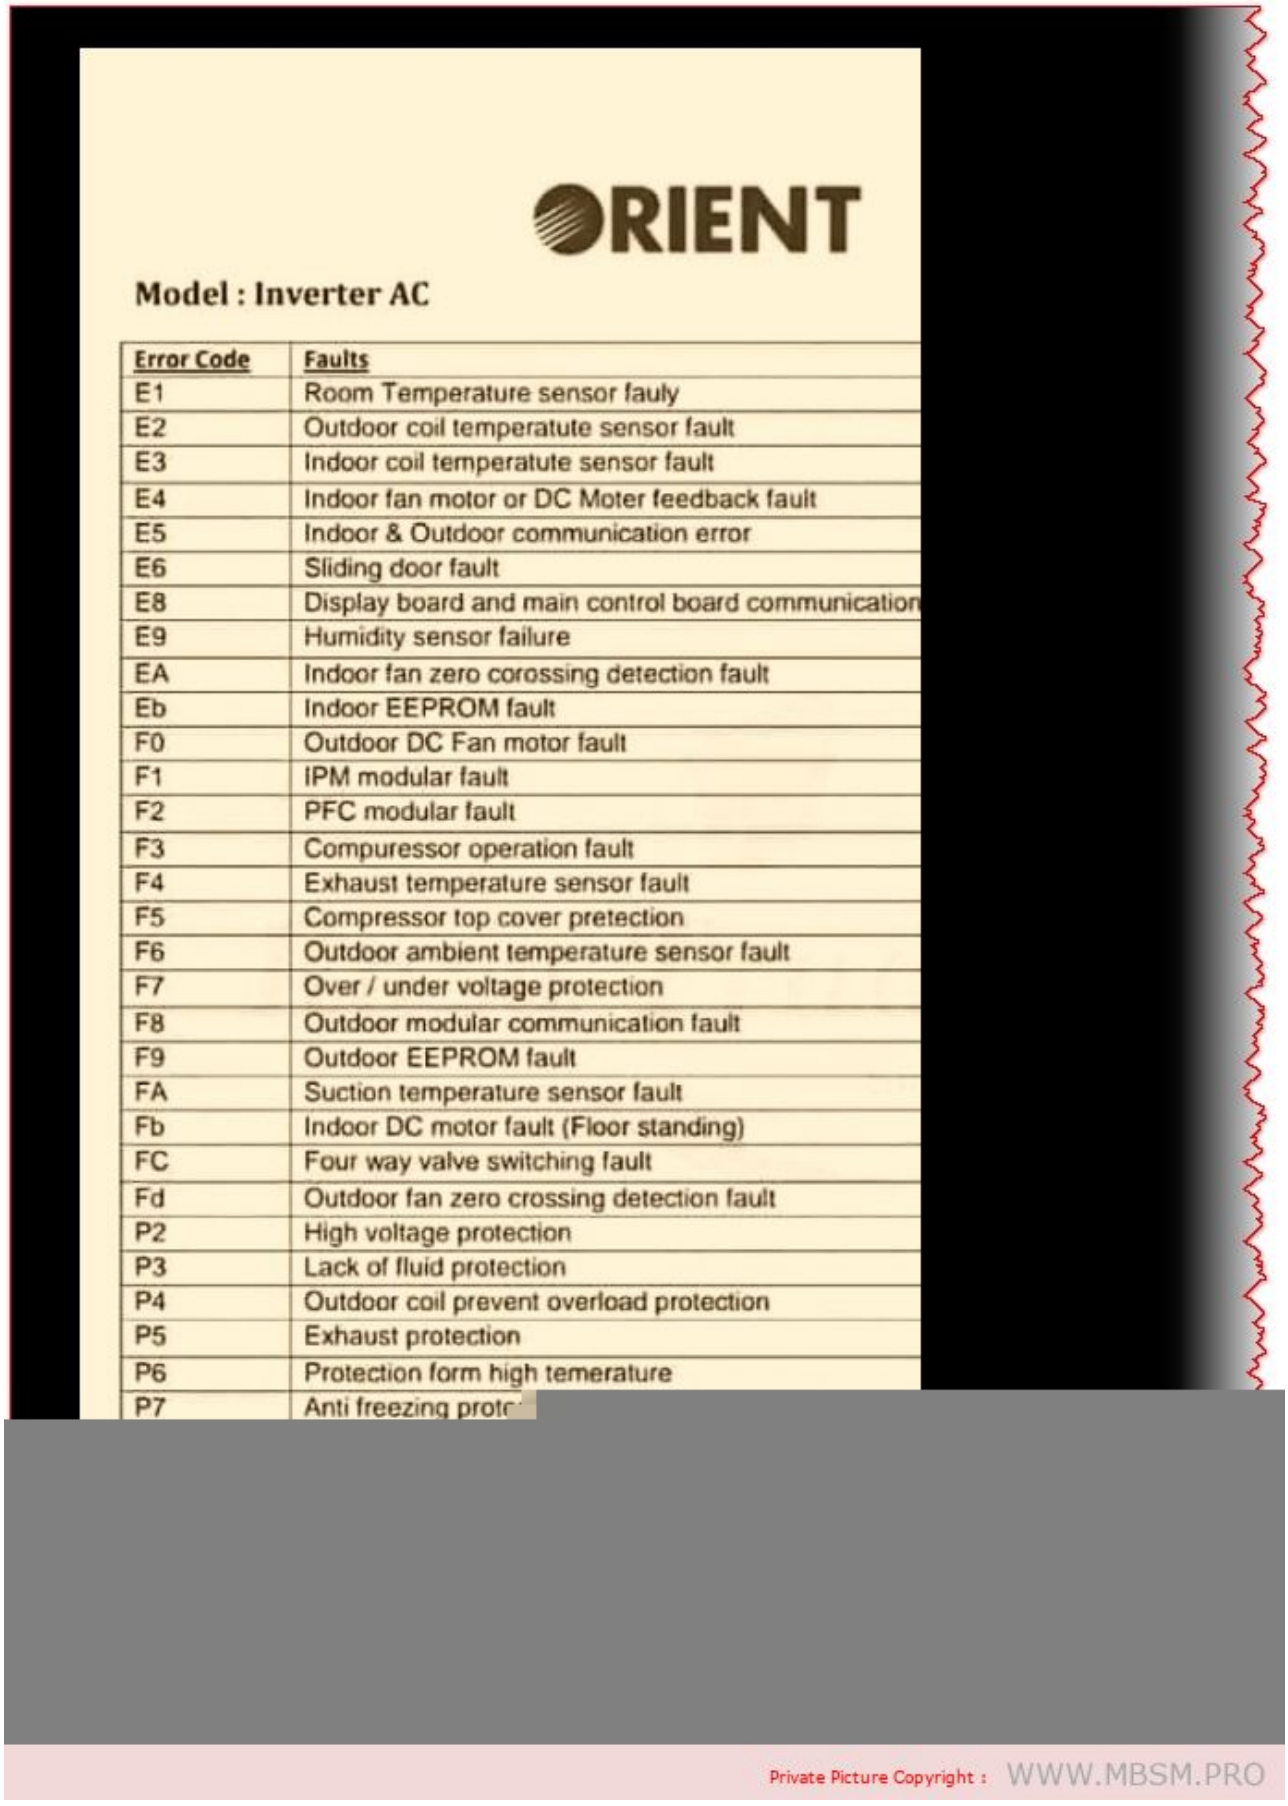

ORIENT

Model : Inverter AC

Error Code	Faults
E1	Room Temperature sensor fauly
E2	Outdoor coil temperatute sensor fault
E3	Indoor coil temperatute sensor fault
E4	Indoor fan motor or DC Moter feedback fault
E5	Indoor & Outdoor communication error
E6	Sliding door fault
E8	Display board and main control board communication
E9	Humidity sensor failure
EA	Indoor fan zero corossing detection fault
Eb	Indoor EEPROM fault
F0	Outdoor DC Fan motor fault
F1	IPM modular fault
F2	PFC modular fault
F3	Compuressor operation fault
F4	Exhaust temperature sensor fault
F5	Compressor top cover pretection
F6	Outdoor ambient temperature sensor fault
F7	Over / under voltage protection
F8	Outdoor modular communication fault
F9	Outdoor EEPROM fault
FA	Suction temperature sensor fault
Fb	Indoor DC motor fault (Floor standing)
FC	Four way valve switching fault
Fd	Outdoor fan zero crossing detection fault
P2	High voltage protection
P3	Lack of fluid protection
P4	Outdoor coil prevent overload protection
P5	Exhaust protection
P6	Protection form high temerature
P7	Anti freezing prote

Private Picture Copyright : WWW.MBSM.PRO

Discover comprehensive troubleshooting for ORIENT inverter AC systems. This complete error code guide covers E-series, F-series, P-series, and L-series fault codes with detailed solutions for sensor issues, communication failures, compressor problems, and electrical protection systems affecting your cooling performance.