

# Kulthorn, compressor, Kulthorn compressor, c-qn76l6f, c-qn76l6f-l, 1/10 Hp, 1Ph, Serie C-q, R134a, 76 watt, Low back pressure, 200-220V/50hz, 220v/60hz, Compressor modefier

Category: compressor

written by [www.mbsm.pro](http://www.mbsm.pro) | 7 January 2021



Private Picture Copyright : [WWW.MBSM.PRO](http://WWW.MBSM.PRO)

Kulthorn, compressor, Kulthorn compressor, c-qn76l6f, 1/10 Hp, 1Ph, Serie C-q, R134a, 76 watt, Low back pressure, 200-220V/50hz, 220v/60hz, Compressor modefier  
Compressor Motor Protectors

Each compressor incorporates a motor protection device or system. Generally, the larger the compressor, the more sophisticated the motor protector.

It is essential that an electric motor is protected against conditions that could

otherwise result in damage to the motor or to the electrical supply system. For this

reason, every Kulthorn compressor is supplied with a motor protector, sometimes referred

to as an overload. The more expensive the compressor, the greater is the

economic

justification for specifying a motor protector that has the ability to protect over a wider range of conditions.

#### 1. External Motor Protectors

A smaller compressor (such as an AZ, AE or WJ) is fitted with an external motor protector. Most commonly, this is a compact, cylindrical device that contains a snapaction bimetallic disc. The protector is mounted in contact with the surface of the compressor housing, inside the terminal guard.

The compressor current passes through the bimetallic disc. The resistance of this disc

causes the disc temperature to increase as the motor current increases. There is usually

a small heater, located under the disc and connected in series with the disc itself. This

heater further raises the temperature of the disc. There is also the impact of the

compressor shell temperature, and a hot compressor will further increase the disc

temperature. The temperature of the disc is thus influenced by the combined effects of –

- the compressor motor current
- the compressor shell temperature

When the bimetallic disc reaches a predetermined temperature (often either 105°C or

120°C) the disc will snap open, and power supply to the compressor will be interrupted.

The compressor will cool, and at a reduced disc temperature the protector will reset

and the compressor will restart, or attempt to restart. If the abnormal condition that

caused the protector to trip in the first place still exists, the compressor is likely to continue

to cycle on the overload until that condition is corrected.

There are two situations where a motor protector is expected to operate.

#### 2. When the compressor is running under extreme conditions.

#### 3. When the compressor is in a locked rotor condition. This is a situation where the

compressor cannot start because the voltage is too low, the system pressures are

outside the range for which the compressor is approved, there is internal damage to

the compressor, or there is some other reason why the compressor is incapable of

starting



 **KULTHORN**

870611-00002043

**C-QN76L6F-L**

80377116

220-230V~ 60Hz

220V~ 50Hz

1PH



115.810-0548

R134a


RoHS



**28031**

MADE IN THAILAND

## Model Number System

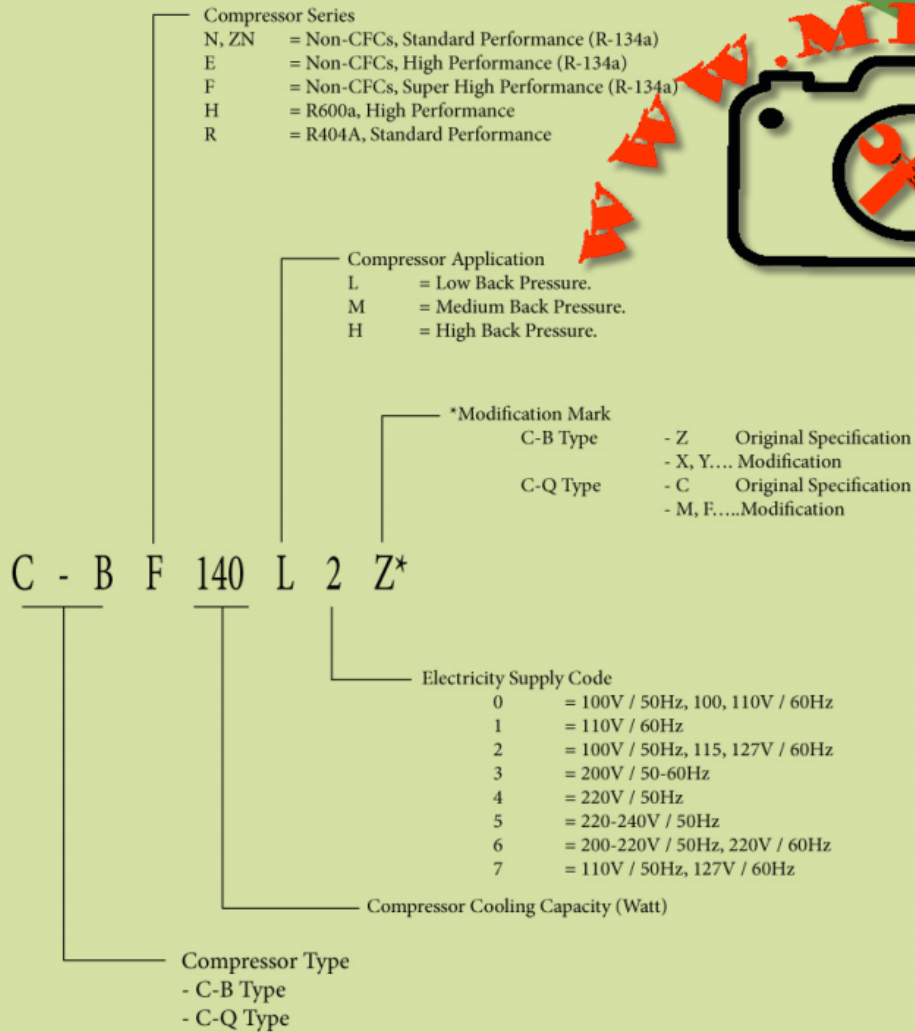

Private Picture Copyright : [WWW.MBSM.PRO](http://WWW.MBSM.PRO)

Mbsm\_dot\_pro\_private\_PDF\_2019-06-13\_110312\_technical\_bulletinTélécharger

Mbsm\_dot\_pro\_private\_PDF\_kpccatalogTélécharger

Mbsm\_dot\_pro\_private\_PDF\_KULTHORN-CATALOGUE\_webTélécharger

Mbsm\_dot\_pro\_private\_PDF\_Kulthorn-CatalogTélécharger

Mbsm\_dot\_pro\_private\_PDF\_Model-Number-SystemTélécharger



# KULTHORN

## COMPRESSOR

Private Picture Copyright : [WWW.MBSM.PRO](http://WWW.MBSM.PRO)

Name: Kulthorn Premier Company Limited (KPC)  
 Established: December 1982  
 Registered Capital: Baht 1,125 Million  
 Address: 446/3 Moo 9 Chachoengsao – Nakornratchasima Road,  
 Kabinburi Industrial Estate, Nongki, Kabinburi, Prachinburi 25160, Thailand  
 Telephone: (037) 204835, 455516  
 Fax: (037) 455525, 204844  
 E-mail: sales\_kpc@kulthorn.com  
 kamjorn@kulthorn.com  
 Employees: 900 persons  
 Land area: 91 rai (145,600 m<sup>2</sup>)  
 Building of area: 41,500 m<sup>2</sup>  
 Business Products: Hermetic Reciprocating Compressor (Scotch Yoke Mechanism)  
 (Product under license SANYO Japan) Size 30-250 Watt.  
**Compressor series / Refrigerant**  
 C-BN, C-BZN, C-BE, C-BF / R-134a  
 C-QN / R-134a  
 C-BH / R-600a  
 C-BR / R-404A  
 Shareholder: Kulthorn Kirby Public Company Limited 100%  
 Customers: **Domestic** – Haier, Sanyo, Toshiba, Hitachi, Daewoo, Samsung, Sanden, etc.  
**Total = 35%**  
**Export** – Daewoo, Sanyo Group, GE, Sanden, Haier, Singer, Videocon,  
 Toshiba, etc.  
**Total = 65%**  
 Quality System: ISO 9001:2000 Certified by TUV Nord Year 2003  
 Q-Mark Certified by F.T.I. Year 2007

